
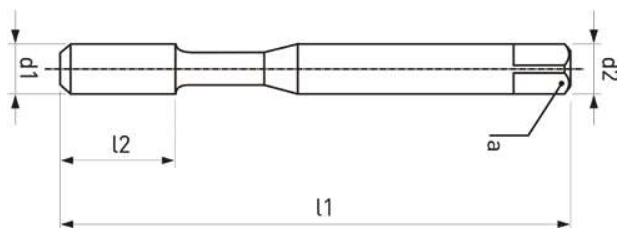


D Maschinengewindebohrer gerade genutet, für Whitworth-Gewinde BSW, DIN 11

E Machine taps straight fluted, for whitworth threads BSW, DIN 11

I Maschi a macchina scanalature diritte, per filettatura whitworth BSW, DIN 11

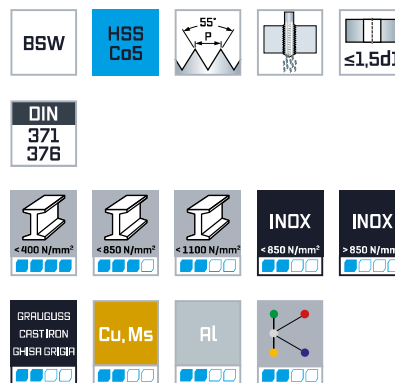

d1 mm	P Gg/1"	l1 mm	l2 mm	d2 mm	ah ₁₂ mm		Code 5207 Art.-Nr.
BSW 1/8"	40	56	11	3,5	2,7	Ø 2,55	0520701600100
BSW 5/32"	32	63	13	4,5	3,4	Ø 3,2	0520701700100
BSW 3/16"	24	70	15	6	4,9	Ø 3,7	0520701800100
BSW 1/4"	20	80	17	7	5,5	Ø 5,1	0520702000100
BSW 5/16"	18	90	20	8	6,2	Ø 6,5	0520702200100
BSW 3/8"	16	100	22	9	7	Ø 7,9	0520702400100
BSW 7/16"	14	100	22	11	9	Ø 9,25	0520702600100
BSW 1/2"	12	110	25	12	9	Ø 10,5	0520702800100
BSW 9/16"	12	110	26	11	9	Ø 12	0520703000100
BSW 5/8"	11	110	27	12	9	Ø 13,5	0520703200100
BSW 3/4"	10	125	30	14	11	Ø 16,4	0520703400100
BSW 7/8"	9	140	32	18	14,5	Ø 19,25	0520703600100
BSW 1"	8	160	36	20	16	Ø 22	0520703800100



HSS-Gewindewerkzeuge
HSS taps and dies
HSS maschi e filiere

DIN 371 = BSW 1/8" - BSW 1/2"
DIN 376 = BSW 9/16" - BSW 1"